



SMP7 Power Supply/Charger

Overview:

Altronix SMP7 is a power supply that converts a low voltage AC input into 12VDC or 24VDC output with a 6A continuous supply current.

Specifications:

Input:

- Input 28VAC
(*Voltage Output/Transformer Selection Table*).

Output:

- 12VDC or 24VDC selectable output.
- 6A supply current.
- Output fuse is rated 15A/32V.
- Filtered and electronically regulated outputs.
- Short circuit and thermal overload protection.

Battery Backup:

- Built-in charger for sealed lead acid or gel type batteries.
- Maximum charge current 0.7A.
- Zero voltage drop when switching over to battery backup.

Indicators:

- AC input and DC output LED indicators.

Board Dimensions (*W x L x H approximate*):

7" x 4.25" x 1.25" (177.8mm x 107.9mm x 31.75mm).

Voltage Output/Transformer Selection Table:

Output VDC	Switch Position	Max. Load DC	Transformer Requirements (Recommended Altronix Part #'s)
12VDC	SW1 ON	6A	24VAC or 28VAC / 175VA (T2428175)
24VDC	SW1 OFF	6A	24VAC or 28VAC / 175VA (T2428175)

Installation Instructions:

The SMP7 should be installed in accordance with The National Electrical Code and all applicable Local Regulations.

1. Mount SMP7 in the desired location/enclosure (mounting hardware included).
2. Set SMP7 to the desired DC output voltage by setting the SW1 switch (*Fig. 1a, pg. 2*) to the appropriate position (*Voltage Output/Transformer Selection Table*).
Adjust output voltage by using the trimpot on the power supply board (*Fig. 1a, pg. 2*) prior to connecting devices.
3. Connect proper transformer to terminals marked [AC] (*Voltage Output/Transformer Selection Table*).
Use 18 AWG or larger for all power connections (Battery, DC output).

Keep power-limited wiring separate from non power-limited wiring (115VAC / 60Hz Input, Battery Wires). Minimum 0.25" spacing must be provided.

CAUTION: Do not touch exposed metal parts. Shut branch circuit power before installing or servicing equipment. There are no user serviceable parts inside. Refer installation and servicing to qualified service personnel.

4. Measure output voltage before connecting devices. This helps avoiding potential damage.
5. Connect devices to be powered to terminals marked [– DC +].
6. When the use of stand-by batteries is desired, they must be lead acid or gel type. Connect battery to the terminals marked [– BAT +] on the board (battery leads included). Use two (2) 12VDC batteries connected in series for 24VDC operation.

Note: When batteries are not used, a loss of AC will result in the loss of output voltage.

LED Diagnostics:

Red (DC)	Green (AC)	Power Supply Status
ON	ON	Normal operating condition.
ON	OFF	Loss of AC. Stand-by battery is supplying power.
OFF	ON	No DC output.
OFF	OFF	Loss of AC. Discharged or no stand-by battery. No DC output.

Terminal Identification:

Terminal Legend	Function/Description
AC/AC	Low voltage AC input (24VAC or 28VAC / 175VA).
- DC +	12VDC / 24VDC @ 6A continuous output.
- BAT +	Stand-by battery connections. Maximum charge rate 0.7A.

Fig. 1


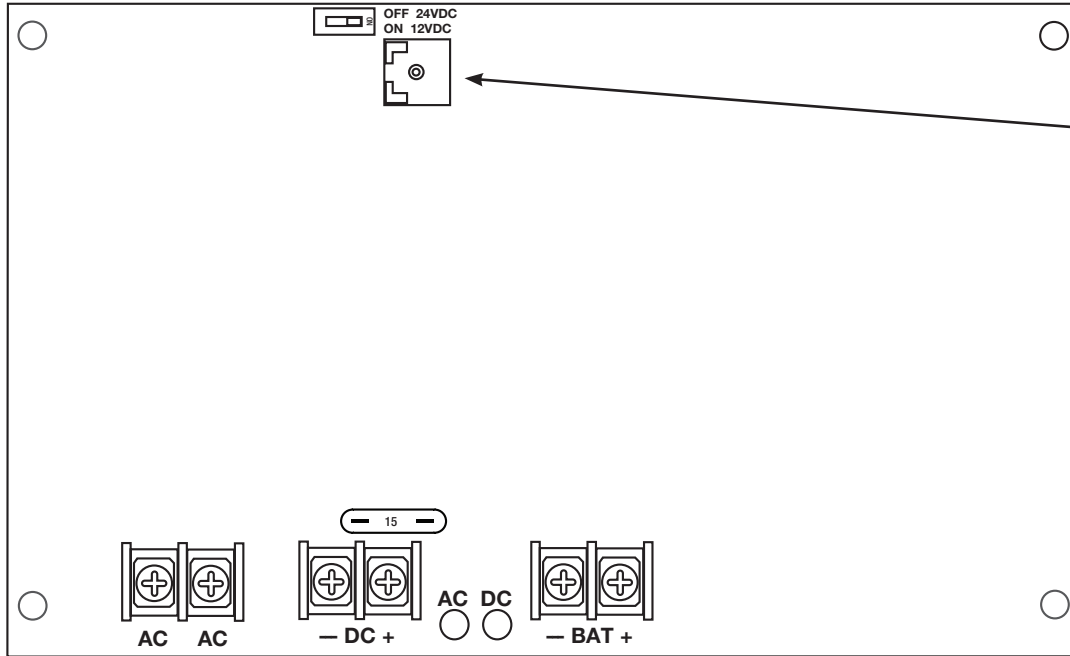


Fig. 1a

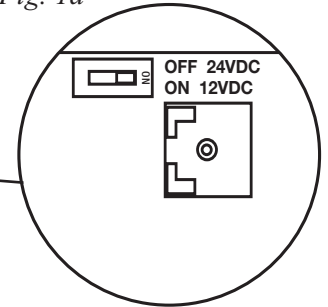

Altronix is not responsible for any typographical errors. Product specifications are subject to change without notice.

140 58th Street, Brooklyn, New York 11220 USA | phone: 718-567-8181 | fax: 718-567-9056
 website: www.altronix.com | e-mail: info@altronix.com | Lifetime Warranty | Made in U.S.A.
 IISMP7 - Rev. 110606

B26S

